



**Cobra Motorcycle Mfg.**

240 Uran street  
Hillsdale, MI 49242

(517) 437-9100 phone  
(517) 437-9101 fax

## TSB1408 CX50 JR / OI radiator

May 1, 2008

The radiator (ECMU0061) for the Cobra CX50 JR & OI is now silver and is being produced by a different supplier. Besides the change in color there is also a geometry change to the radiator. Most importantly the radiator is larger and so requires some changes to the mounting.

The part number for the new radiator is ECMU0225. When an ECMU0061 is ordered from the factory, an ECMU0225 radiator and new mounting hardware will be shipped. If an ECMU0225 is ordered just a radiator will ship.

1. The bottom radiator mount must now be mounted upside down from the previous mounting arrangement. Proper bracket orientation is shown in Figure A and there is a washer between the grommet and the radiator.
2. A spacer is supplied to aid in mounting the radiator in a true horizontal position. The spacer goes between the bracket and the frame on the upper mount (Figure B).

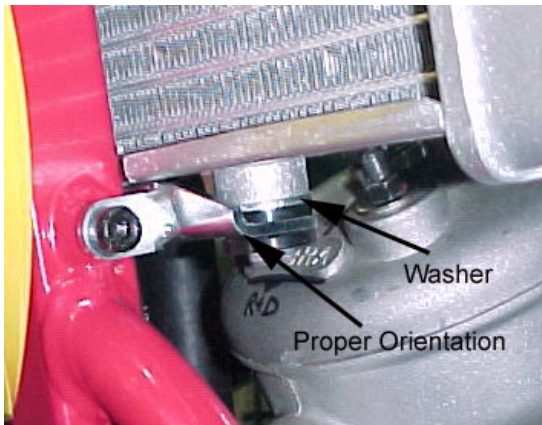


Figure A

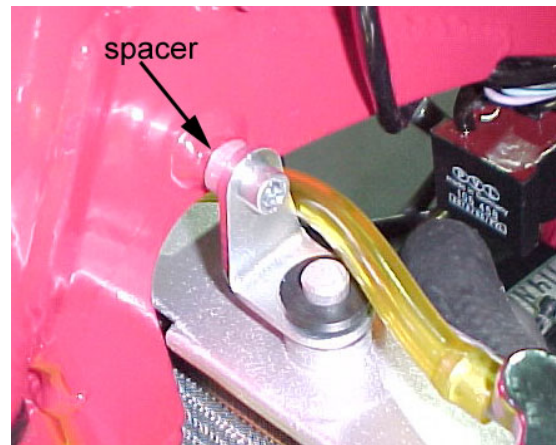


Figure B